

Document ID# 1527280
2004 Cadillac CTS

4T65-E Automatic Transmission Fluid Leak From Reverse Servo Cover (Replace Reverse Servo Cover and Seal) #04-07-30-028 - (Jun 15, 2004)

4T65-E Automatic Transmission Fluid Leak From Reverse Servo Cover (Replace Reverse Servo Cover And Seal)

2004 and Prior Cars and Light Duty Trucks

with Automatic Transmission 4T65-E (RPOs MN3, MN7, M15, M76)

Condition

Some customers may comment on a fluid leak under the vehicle.

A transmission fluid leak may be noted during the Predelivery Inspection (PDI).


Cause

A possible cause of a transmission fluid leak usually only during cold ambient temperatures below - 6.7° C (20° F) may be the reverse servo cover/seal. The reverse servo cover seal may shrink in cold ambient temperatures causing a transmission fluid leak.

Correction

Follow the diagnosis and repair procedure below to correct this condition.

1. Diagnose the source of the fluid leak. Refer to Fluid Leak Diagnosis, SI Document ID #634313.

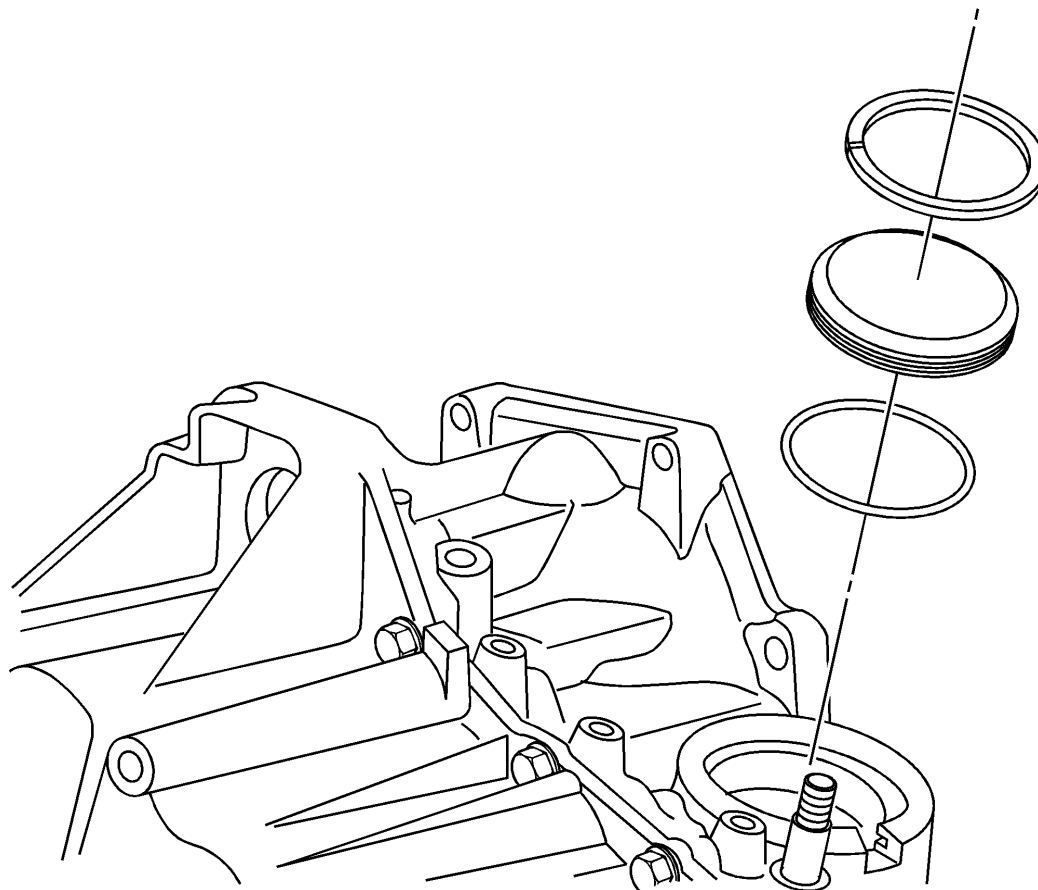

2. If the source of the transmission fluid leak is the reverse servo cover, replace the reverse servo cover and seal with P/N 24207376. Refer to Reverse Servo Replacement in the appropriate service Manual.
3. Clean the area around and below the cover.
4. Inspect the transmission fluid level. Refer to Transmission Fluid Checking Procedure in the appropriate service Manual.

Parts Information

Part Number	Description	Qty
24207376	Cover, Reverse Servo Cover with Seal	1

Parts are currently available from GMSPPO.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
K6623	Servo Assembly, Reverse - R&R or Replace	Use Published Labor Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



**WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION**

© Copyright General Motors Corporation. All Rights Reserved.

**Document ID# 1527280
2004 Cadillac CTS**